


UPDATE: REALISTIC TRC-216

Where is the modulation limiter ? ? ? It must be pulled to make this unit do "it's thing".

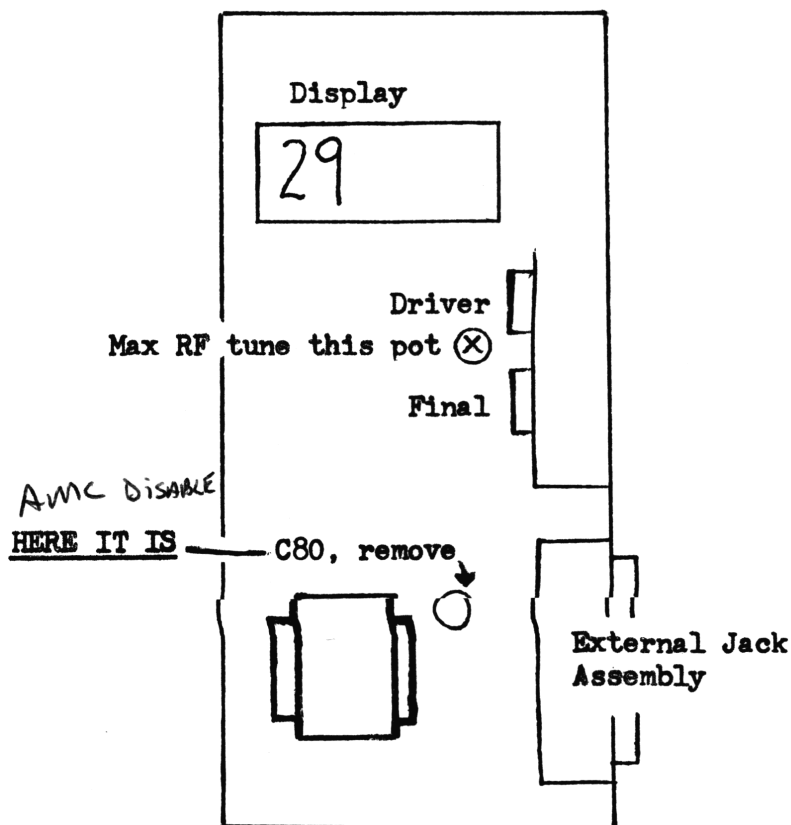

---

UPDATE: ANTLAFIER Linear Amp.

CAUTION: The design of this unit has the bias on Final set full blast!  
So - no swing.... This is why so many have been going bad.

---

UPDATE: MOSQUITO Linear Amp.

CAUTION: If the unit has blown RF Transistor, double-check the switch for high resistance. Many have gone bad and been the real reason for problem. Suggest removing CAREFULLY and hardwiring the unit permanently ON. (The reason for ON being underlined is that have received two units for repair that were wired OFF?)  
Fuse unit with a 3A fast blow.