

browning®

SERVICE
NOTES



80412

GOLDEN EAGLE MARK IV

RECEIVER

SYMPTOM: Long warm-up time with 1/2 Channel or more Drift before becoming stable.

SOLUTION: Change C127 from 10 PF N220 to 20 PF N750 (2-0249) and C128 from 47 PF Mica to 39 PF NPO (2-0266) and recalibrate dial. See Service Manual.

This should give less than 1000 Hz drift during warm up and should be stable after 15 - 20 minutes.

After the set is warm it may drift slightly more over a period of several hours than it did before but we now feel the faster warm up with less initial drift is more important.