



Consumer Response Group

6500 W. Cortland Street * Chicago, IL 60707 * Phone: 773-889-8870 * FAX: 773-622-2269

May 14, 2002

Page 1 of 1

TECHNICAL SERVICE BULLETIN 10015

- MODEL(S):** 148 GTL, 148 GTL ST, 148 NW ST
- DESCRIPTION:** Warble when transmitting on sideband. This can occur if the power supply cannot keep up with the power demands of the transmitter.
- ACTION:** Replace C172 with a 2200 μ F capacitor.
- ADJUSTMENTS:** None.
- NOTES:** If C172 is changed to 2200 μ F, it may make the radio more susceptible to alternator noise. For this reason change C172 only when necessary. If alternator noise becomes a problem then install a filter on the alternator.