



Consumer Response Group

6500 W. Cortland Street * Chicago, IL 60707 * Phone: 773-889-8870 * FAX: 773-622-2269

December 3, 2002

Page 1 of 3

TECHNICAL SERVICE BULLETIN 10017

MODEL(S): 19 DX III

DESCRIPTION: Excessive feedback when using PA.

ACTION: There is too much microphone gain for the PA function, which makes the radio excessively prone to acoustic feedback.

To correct, install a 10K ohm resistor from the open contact on the PA switch to the collector of Q12. Put an insulating sleeve over the resistor.

Refer to the pictures on pages 2 and 3.

ADJUSTMENTS: None.

NOTES: None.



