



Consumer Response Group

6500 W. Cortland Street * Chicago, IL 60707 * Phone: 773-889-8870 * FAX: 773-622-2269

April 12, 2006

Page 1 of 2

TECHNICAL SERVICE BULLETIN

10051 Rev. A

MODEL(S): 200GTL

DESCRIPTION: Modulation may be low with some noise canceling microphones.

ACTION: If modulation is low with an aftermarket microphone, then change R178 and R182 to 82K Ω .

See page 2 for the location of R178 and R182.

ADJUSTMENTS: None.

NOTES: It may be easier to access the resistors if you temporarily remove C147.

If at some later date a different microphone is used (one with a higher audio output), it may be necessary to turn down the Mic Gain.

