


\*\*\*MODIFICATIONS\*\*\*


EAGLE - Model 500

DRIVER MODIFICATION:

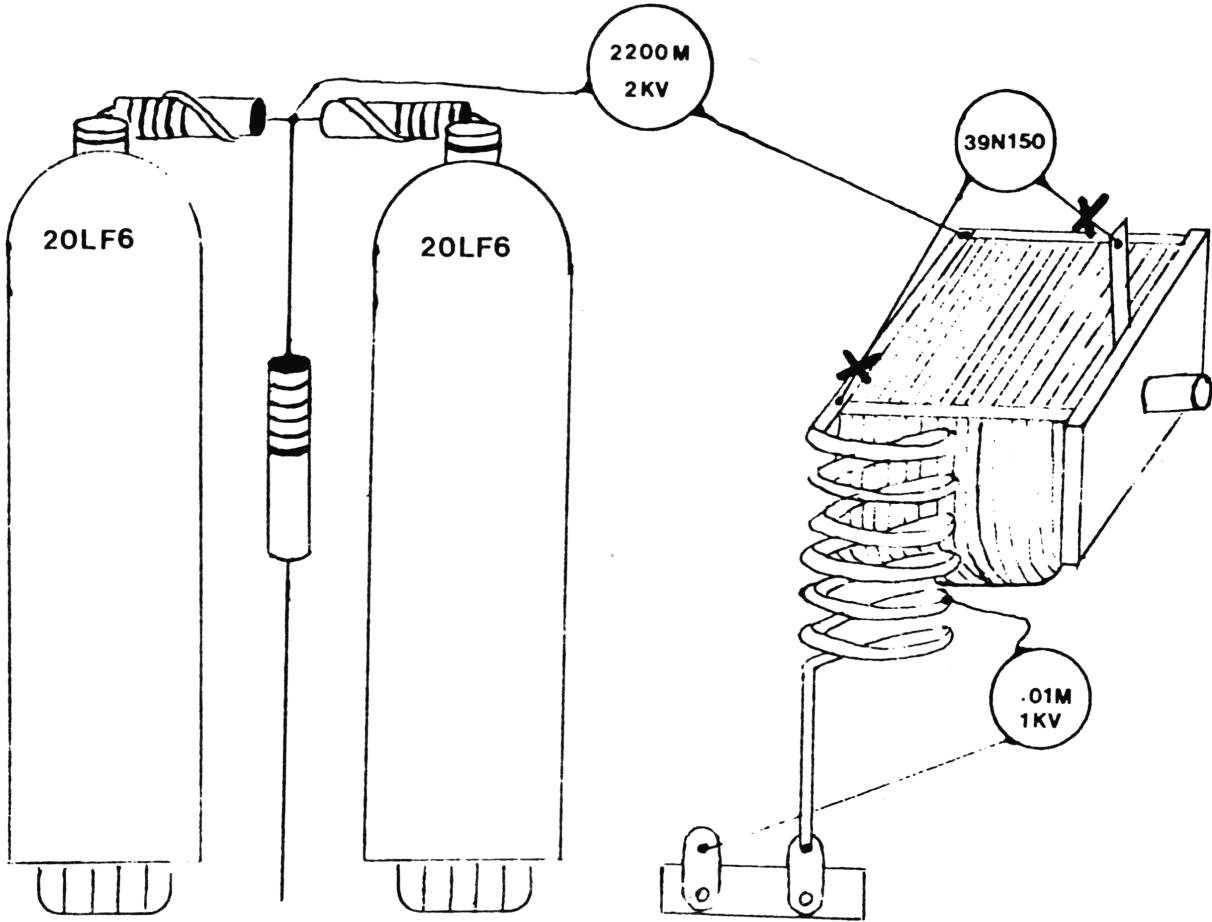

Factory Issue as depicted above. To modify, remove capacitor (39N150) across Drive Control. Cut as indicated by "X's".

OUTPUT MODIFICATION:

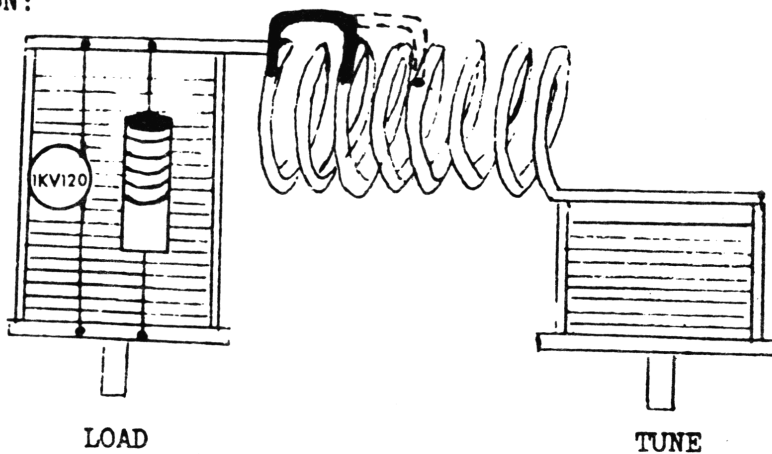

Factory Issue as depicted above. To modify, move strap on coil between "Load" and "Tune" from third turn (as per factory issue) to fifth turn (as indicated above).