

TRUBLE SPOT


B.W.

"GENERIC" - Jackson ? : Yep, comes with no name on front panel and microphone. It is so plain that is packed in white unmarked box, no owner's manual, frequency chart, or schematic....

Not to worry as have found the only difference to be at the DC power connector, remainder of unit is identical to units marked Jackson! 'Generic - Jackson' S/N: 43001853...

This particular unit was received by me for customer, prior to sale was to checkout and realign if necessary. Hooked up to power, switch off, - blew fuse! Pulled covers off for look see, as didn't want to return to 'Distributor' if I could fix myself.

"Spare us all" - looked like the Screwdriver Jockey went on vacation to Taiwan. In an effort to be standard to most CB 3-pin power cable as used in the U.S. - jumpered across the plug..... BUT, was done as diagramed below. Suggest that you remove covers from Generic units and check out the power plug area as a precaution.

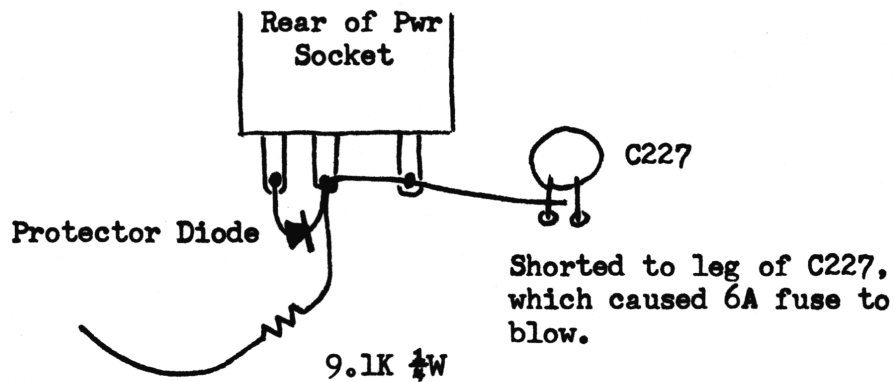

? Used this resistor as piece of jumper, but forgot to cut off the excess leads on both ends, double-check!

Out-of-Box checkout, finally - AM/FM-11W+, SSB-7W Max? Readjusted power to AM/FM-17W, and SSB to 25W (This way unit will coast for a long time and be trouble-free). Also put the extended slide in Vol. 20, page 28; into unit - worked exactly as written. The only major gripe is: not enough adjustment on VR7 even when turned fully CCW.

CORRECTION: Vol. 20, Pg. 40.

GRANT-DX (Fo Mod).

CHANGE: Pin number from 8 to 9, see partial drawing correction.

