


Installation of Kit 89-1 in JC Penny 981-6237

When this kit was installed according to instructions it would not work. Reread instructions and rechecked connections, everything was right but still no frequencies. After adjusting got the High frequencies but no Lows and lost the normal 40.

Had to experiment but found the right spot to hook in to. The kit may not lock-in all frequencies as the VCO has a limited range.


See hook up below.

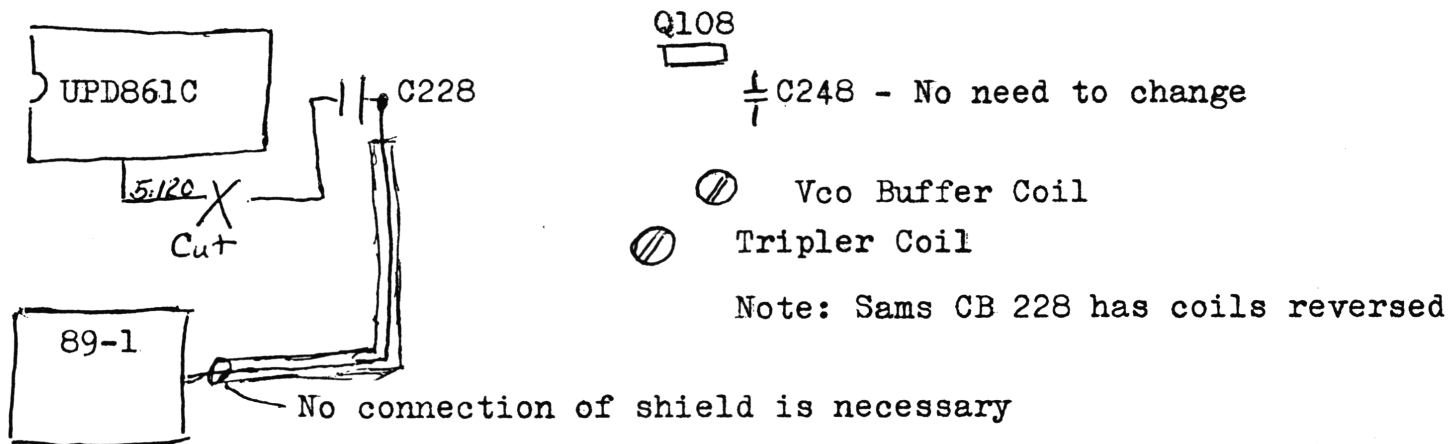

No need to adjust tripler coil, it works just fine.

Clarifier Voltage regulation in all radioes.

Still have a radio that shifts between receive and transmitt?
Try the following circuit. It has cured quite a few problems for me.

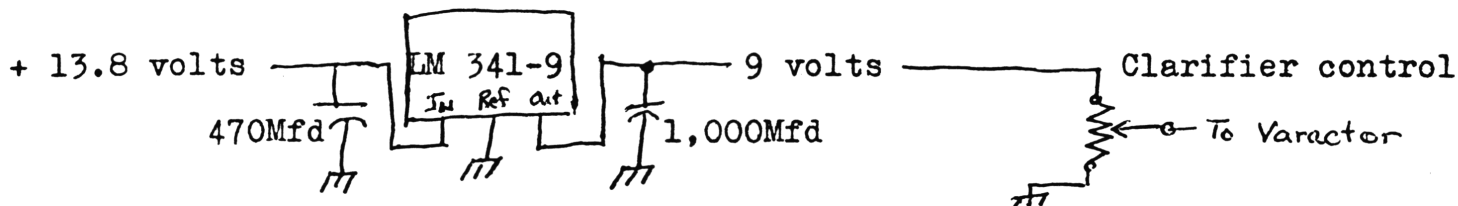

This regulated voltage does not drop even .1 volts when the radio is in the transmitt mode.