

CAUTION—DOUBLE BOARD EXPORTS!


Below is list of O2A PLL Double-Board Export Chassis known to exist at this time. BEWARE, as will run into same service problems as U.S. versions! Major 360, Major M588, Multimode II, Ham International Concorde-(Not the Concorde II), Lafayette 1200FM. If anyone finds additional units pass along the info - might save someone a lot of headaches!

COBRA 150GTL OWNERS

I have been told that to have an INTEC 1200FM, all you do is peel off the COBRA label! Presto, you got it..... Someone set the record straight on this! Does the label say: Cobra 150GTL or Cobra GTL-150? Also need Fo's/PLL type...

DOUBLING UP FOR CURRENT!

The 'newer' model Uniden Exports won't run on the normal 2.5-3.5A Reg. Power Supplies (especially the R/S #22-124/A's). Go buy another and hook-up in parallel - FIRST - "Carefully" drill out the pop rivets on case and remove all existing wiring to the + terminal. Modify BOTH as shown below: 6A/100V Rectifier Diode (Minimum Rating) in series to + terminal.

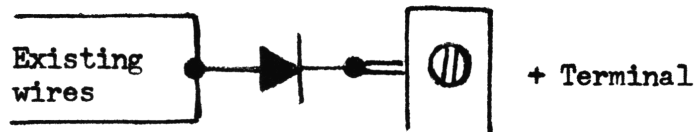

SECOND - Hook up both units in parallel, then the transceiver to either.

(Use insulated ring tongue hardware)

